
BEVI Electric motors, IEC 56-400

Installation and service instruction

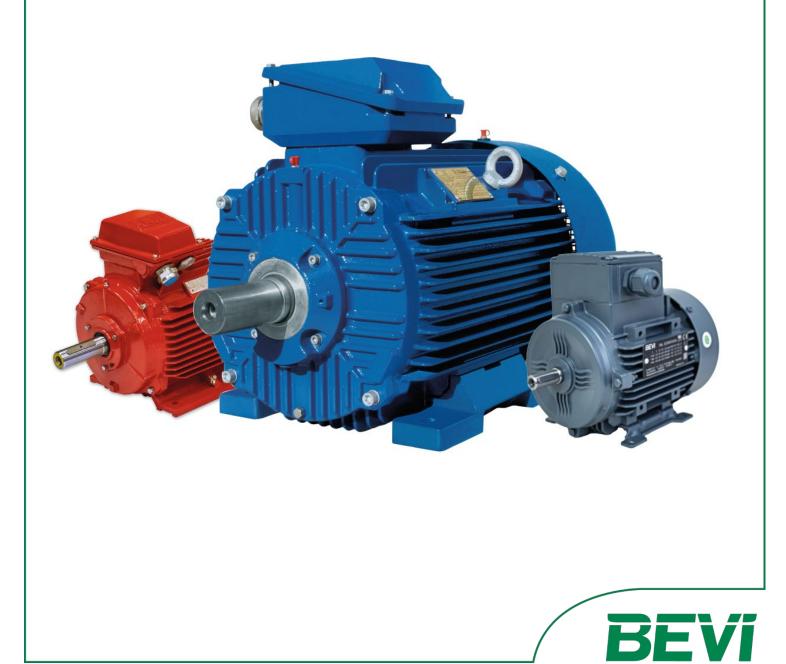

Every care has been taken to ensure the accuracy of the information contained in this publication.

Due to BEVI's policy of continuous development and improvement, BEVI reserves the right to supply products which may differ slightly from those illustrated and described in this manual.

Descriptions and technical features listed in this manual may not to be considered as binding. Under no circumstances should be considered as a contractual obligation.

The data in this manual may change without prior notice.

Table of content

| 1 | Тес | hnical description | |
|---|------------|---|------|
| | 1.1 | General | |
| | 1.2 | Enclosure | |
| | 1.3 | Cooling | |
| | 1.4 | Insulation | |
| | 1.5 | Voltage and frequency | |
| | 1.6 | Surface | |
| | 1.7 | Terminal box and terminals | |
| _ | 1.8 | Motor dewatering (drain holes) | |
| 2 | | ndards and directive | |
| 3 | | ety information | |
| 4 | Han | ndling | 6 |
| | 4.1 | Reception of motor | 6 |
| | 4.2 | Transport and storage | 6 |
| | 4.3 | Lifting of motors | |
| 5 | Inst | allation and commissioning | 7 |
| | 5.1 | General | |
| | 5.2 | Foundation | |
| | 5.3 | | |
| | 5.4 | | |
| | 5.5 | 5 | |
| | 5.6 | Balancing | |
| | 5.7 | Mounting of the motor 7.1 Coupling drives | |
| | | 1 5 | |
| | | 7.2 Belt drives | |
| | | 7.3 Drain plugs | |
| _ | 5.8 | Electrical connection | |
| 6 | | necting options | |
| | 6.1 | Direct on-line (DOL) start | |
| | 6.2 | Star/Delta (Y/D) start | |
| | 6.3 | Output from motor during special ambi | |
| | | tions 3.1 Ambient temperature | |
| | | 3.2 Altitude | |
| | | 3.3 Different supply | |
| | | Frequency inverter operation | |
| | | 4.1 Motor cooling | |
| | | 4.2 Thermal protection | |
| | | 4.3 Bearing currents | |
| | | 4.4 EMC and cables | |
| _ | - | | |
| 7 | | ecklist at motor start-up | |
| 8 | | ntenance | |
| | 8.1 | Service of motor during operation | |
| | 8.2 | Periodical inspections | |
| - | 8.3 | Bearings and lubrication – general | |
| 9 | - | ions | |
| | 9.1 | Thermocontacts | |
| | 9.2 | Thermistors (PTC) | |
| | 9.3 | PT100 sensors | |
| | 9.4 0.5 | Forced ventilation (IC416) Anti-condensation heaters | |
| | 9.5 9.6 | Motor winding anti-condensation | |
| | J.U | motor winding and-condensation | . 10 |

| 9.7 Mech | anical brake | 16 |
|---------------|------------------------------------|------|
| 10 Specific n | notor data | . 17 |
| 10.1 Explo | ded views | 17 |
| | ening torque | 18 |
| | Sh, 2SIE, 3SIE, 4SIE, SEMh, | |
| | | |
| 10.3.1 | Construction | |
| 10.3.2 | | |
| 10.3.3 | | |
| | Connection diagrams Sh, 2SIE | |
| | IE, SEMh, 3SSIE | |
| 4D4 24 | 4A, 4A2, 4A3, 4A4, 4D, 4D2, 4D | |
| 10.4.1 | Construction | |
| 10.4.2 | Bearings 4A, 4A2, 4A3, 4A4, 4 | D, |
| 4D2, 4D3 | 3, 4D4 | |
| 10.4.3 | Lubrication interval | |
| 10.4.4 | Connection diagrams 4A, 4A2, | |
| | 1, 4D, 4D2, 4D3, 4D4 | |
| | 3D, 3D2, 3D3, 3D4 | |
| 10.5.1 | Construction | |
| 10.5.2 | 0 1 1 | |
| 10.5.3 | | |
| | Connection diagrams 3D, 3D2, | |
| 3D3, 3D4 | | |
| | drying motors type 3DT, 3DT2, | |
| | 4 | 31 |
| 10.6.1 | Specific features for motors typ | |
| | T2, 3DT3, 3DT4 | |
| 10.6.2 | | |
| 10.6.3 | Bearings 3DT, 3DT2, 3DT3, 3D 31 |)T4 |
| 10.6.4 | Connection diagrams 3DT, 3D | Г2, |
| 3DT3, 3[| DT4 | |
| 10.6.5 | Lubrication interval | . 32 |
| 10.7 Type | 2EL, 3EL, 4EL, 3EC, 2EG, 3EG, | |
| 4EG 33 | | |
| 10.7.1 | Construction | . 33 |
| 10.7.2 | Bearings | . 33 |
| 10.7.3 | Lubrication interval | . 34 |
| 10.7.4 | Connection diagrams 2EL, 3EL | -, |
| 4EL, 3E0 | C, 2EG, 3EG, 4EG | |
| | ooting | |
| | | |

1 Technical description

The persons who are in contact with the motor when installing, operating or maintaining it must follow this manual. Only qualified personnel are allowed to handle the motor. If this – including health and safety regulations – are not followed, no warranty issues will be approved by BEVI.

1.1 General

This manual covers BEVI asynchronous surface-cooled induction three phase motors, single and multiple speed as well as singlephase motors, series;

- Sh, 2SIE, 3SIE, 4SIE, SEMh, 3SSIE
- 3D, 3D2, 3D3, 3D4
- 4A, 4A2, 4A3, 4A4, 4D, 4D2, 4D3, 4D4
- 3DT, 3DT2, 3DT3, 3DT4
- 2EL, 3EL, 4EL, 3EC, 2EG, 3EG, 4EG

The motor's technical specifications are available on www.bevi.com.

All BEVI motors meets the requirements of ISOstandards and the IEC regulations and recommendations available.

If not given otherwise the rated powers are valid for continuous S1 duty, at given supply voltage and frequency, ambient temperature -20°C -+40°C and for motor setting up to an altitude of 1000m above sea level. The motors are for fixed installation only.

1.2 Enclosure

Motors are produced with degree of protection class IP55 as standard. Motors can, without special enclosure modifications, be installed outdoors and the standard paint finish is also suitable. However, for harsh environments and climatic conditions we recommend a special paint finish. Motors mounted with shaft vertically down should be protected by a canopy (rain cap) fitted over the fan cowl to prevent water from following the motor shaft into the motor. For the same reason motors mounted with shaft vertically up should be protected so that water cannot penetrate down the motor shaft. Customized motors can be ordered for IP56, IP65 or IP66 as well.

1.3 Cooling

As standard, cooling is supplied by a fan fitted onto the non-drive (ND) end shaft extension (standard designation IC411). Other cooling methods can be supplied, for example a separate blower (IC416 – forced cooling) fan which is commonly required for inverter driven motors. Note that DT-motors have cooling designation IC418.

1.4 Insulation

All motors conform to the insulation class F unless the mark plate says differently. Motors with Class F can normally be used in wet and dry tropical climate conditions. If the motor needs to comply with especially tough demands, it can be made in special executions for wet alternative dry tropical climate conditions, higher ambient temperatures etc.


As an option the motor can be delivered with class H insulation. DT-motors are equipped with class H as standard.

1.5 Voltage and frequency

BEVI motors can be produced for frequencies of 50 and 60 Hz and all standard voltages up to 690 V. Please look on your motor data plate for actual voltage and frequency.

The impact on temperature rise caused by voltage and frequency fluctuation is defined in IEC 60034-1. The standard divides the combinations into two zones, A and B. Zone A is the combination of voltage deviation of +/-5 % and frequency deviation of +/-2 %. Zone B is the combination of voltage deviation of +/-10 % and frequency deviation of +3/-5 %. This is illustrated in figure below.

Motors can supply the rated torque in both zones A and B, but the temperature rise will be higher than at rated voltage and frequency. Motors can be run in zone B only for a short period of time.

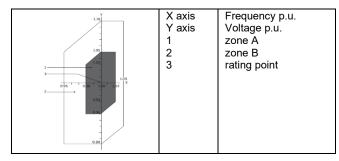

1.6 Surface

BEVI motors are painted with industrial paint as standard, but better painting process is an option, up to CX according to ISO 12944.

1.7 Terminal box and terminals

Motors in the basic execution have six terminals in the terminal box, connected to the stator windings. Multiple speed motors are provided with six or more terminals. The designation of terminals and connection diagram are given on a plate arranged inside the cover of the terminal box.

Motors with thermal protection or with heaters have separate terminals inside the terminal box. There can also be cases when an additional connection strip is provided for connection of this equipment.

1.8 Motor dewatering (drain holes)

Depending on motor size and motor group most of the BEVI motors have drain holes for dewatering the interior of the motor when so is needed. The holes are plugged with a screw or rubber plug and can be removed when needed.

Type Sh, 2SIE, 3SIE, 4SIE and SEMh has drain holes on sizes 56-80 and 132-315.

Type 3D, 3D2, 3D3 and 3D4 has drain holes from size 250 and up.

All other motors can be ordered with drain holes when required as option.

2 Standards and directive

Motor construction, dimensions and outputs comply with the International Standards and directive;

| Standard | |
|----------------|---|
| IEC 60034-1 | Rating and performance |
| IEC 60034-2-1 | Methods for determining |
| 120 00004-2-1 | losses and efficiency |
| IEC 60034-5 | Classification of degrees |
| | of protection |
| IEC 60034-6 | Methods of cooling |
| IEC 60034-7 | Symbols of construction |
| | and mounting |
| | arrangements |
| IEC 60034-8 | Terminal markings and |
| 150,00004,0 | direction of rotation |
| IEC 60034-9 | Noise limits |
| IEC 60034-11 | Built-in thermal protection |
| IEC 60034-14 | Vibration limits |
| IEC 60034-17 | Cage induction motors |
| | when fed from converters |
| IEC 60034-18-1 | Functional evaluation of |
| | insulation system |
| IEC 60034-30-1 | Efficiency classes (IE- code) |
| IEC 60038 | Standard voltages |
| IEC 60072-1 | Dimensions and output |
| | series |
| EU-directive | |
| 2014/35/EU | Low Voltage Directive |
| | (LVD) |
| 2009/125/EC | Ecodesign requirements |
| 0044/05/51 | for electric motors |
| 2011/65/EU | RoHS directive – |
| 2015/863/EU | "Restriction on Hazardous |
| 2006/42/EC1 | Substances" MD – Machinery Directive |
| 2000/42/20 | wid – wachinery Directive |

¹ By design motors are considered as components. Confirmative to the requirements of 2006/42/EC – Machinery Directive, provided

that the installation is set up correctly by the manufacturer of the machine where the motor is placed.

3 Safety information

To avoid accidents during installation, service and inspections of the motor the following work safety principles must be observed:

- The motor must be installed by a qualified electrician, in accordance with the generally in force electrical code principles and regulations.
- Be observant that the motor can have a hot surface, both during operation and after shut-down.
- In no case may the motor operate without protective guards foreseen by the motor construction.
- The coupling or belt drive must be shielded properly protected against touching.
- The motor must be suitably earthed.
- Cables and supply conductors must be properly protected against damaging.
- Do not open terminal box when energized.

Inspections, maintenance, or repairs can be done only upon order and under supervision by appropriately qualified and trained staff in the line of work safety regulations.

Inspections and repairs must take place when the motors are safely disconnected from the mains.

4 Handling

4.1 Reception of motor

When the motor has arrived, directly check the motor for damages that could have occurred during the transport.

After that, be ensured that correct motor has been delivered by checking motor data plate – type description, power, speed, connection, voltage, frequency etc.

4.2 Transport and storage

The motors can be forwarded in any covered transport means free of violent shocks or blows.

Motors with NU roller bearings should have the shaft secured during transport.

Storage of motors can take place in rooms in which:

- max. relative humidity does not exceed 80% at +20°C,
- ambient temperature ranges from 10°C to +40°C, non-condensing.
- there is no access of dusts, gases and caustic vapours as well as other corroding chemical fumes destructive to insulation or casing,
- no vibrations occur.

On the stored motors the machined surfaces should be protected against atmospheric influences by coating them with thick grease or easily removable anticorrosive lacquer. When stored the shaft should be rotated periodically to exercise bearings and grease.

4.3 Lifting of motors

Motors are heavy, when lifting or handling the motor – make sure that no person risks to come under the lifted motor.

When lifting drive units always use lifting handles designed for this purpose.

BEVI motors with a weight over 25 kg are supplied with lifting eye or similar. The lifting eye is dimensioned to lift the motor, if the motor is mounted on other equipment, the motor's lifting eye must not be used.

Before lifting the motor – check that the lifting eye and threaded parts are undamaged. When this is checked, make sure that the lifting eye is tightened.

5 Installation and commissioning

Prior to starting work on the motor, make sure that it is unplugged from the mains.

5.1 General

Check the motor data plate to confirm that cables and overload protections are correctly dimensioned.

5.2 Foundation

The end user is responsible for the foundation where the motor will be mounted.

The foundation will be dimensioned to withstand occurring vibrations and forces.

5.3 Bearings

Before the motor is set up on site, remove bearing protections (if such are provided).

For motors with regreaseable bearings the grease quality shall be checked when the motors have been stored for a period longer than six (6) months. In such case it is best to change the grease using the grease stated in chapters Lubrication interval. It's also possible to use equivalents of these greases. When changing the grease grade the bearings are to be washed with a proper bearing cleaning liquid and dried thoroughly.

5.4 Insulation resistance

Before the motor is set up measure the insulation resistance to frame: The lowest recommended insulation resistance at a winding temperature of approx. 20°C should amount to minimum 20 M Ω for size 56-80, 10 M Ω for size 90-180 and 5 M Ω for size 200-400 (greater than 100 M Ω is recommended before start-up of motor).

The insulation resistance is reduced by 50% for each 10K temperature rise. The resistance is doubling every time the temperature decreased by 10K.

If the measured insulation resistance is lower the motor must be subjected to drying. During the drying process the conditions should be such that the humidity is removed from the windings i.e. at least the terminal box cover must be removed to facilitate the air exchange within the motor.

If drain plugs are mounted, remove them during the drying process. The drying temperature is recommended 60-80°C and must not exceed 100°C.

After the drying process the insulation resistance will be measured again. Remember to remount the drain plugs.

During and directly after measuring the insulation resistance, harmful voltage is present in the terminals. Therefor it is forbidden to touch them. To neutralize the voltage, it is necessary to ground the frame and each winding grounded to the frame.

5.5 Distance for cooling

Whether free flow of cooling air, necessary for proper operation of the motor, will be provided. Minimal distance between the end of the motors frame (fan cover) and other elements:

- IEC 56 71: 12mm
- IEC 80 90: 15mm
- IEC 100 112: 20mm
- IEC 132 225: 40mm
- IEC 250 280: 45mm
- IEC 315: 50mm
- IEC 355 400: 100mm

5.6 Balancing

The rotor is dynamically balanced. The balancing has been done with a half-key fitted to the shaft, according to IEC 60034-14.

5.7 Mounting of the motor

5.7.1 Coupling drives

Since the rotor is dynamically balanced, the balancing has been done with a half-key fitted to the shaft. This means that, to avoid vibrations, coupling halves and pulleys shall be balanced with a half-key, after the making of the keyway.

The installed motor shaft centre line may show a misalignment of up to 0,1mm with respect to that of the driven machine shaft. As reference the clearance (a) of min. 1mm must be allowed between the coupling halves. For sizes 315-400 the minimum value is 1,5mm. See Figure 1 below.

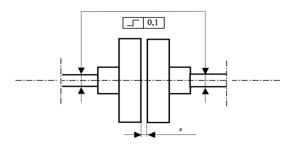


Figure 1. Using coupling on motor shaft.

 


Figure 2 Maximum permissible non-concentricity

b = b2 - b1 = 0,1mm/Ø 200mm

For further information it is recommended to follow the coupling supplier's instructions.

5.7.2 Belt drives

For belt drives the belts must be tightened according to the supplier of the driven equipment. Care must be taken to ensure that the pulleys are in parallel axes.

 


Figure 3 Illustration of belt mounted on shaft

Be certain not to exceed the maximum radial load of the bearing. Otherwise, it may lead to reduced lifetime of bearings and overloading of the shaft.

5.7.3 Drain plugs

Depending on motor size and motor group most of the BEVI motors have drain holes for dewatering the interior of the motor when so is needed. The holes are plugged with a screw or rubber plug and can be removed when needed.

Type Sh, 2SIE, 3SIE, 4SIE, SEMh and 3SSIE has drain holes on sizes 56-80 and 132-315.

Type 3D, 3D2, 3D3 and 3D4 has drain holes from size 250.

All other motors can be ordered with drain holes when required.

5.8 Electrical connection

The motor must be earthed on at least one of the earth terminals on the motor.

In the normal three phase, single speed motor the terminal box contains a terminal board with six terminals, and an earth terminal in the housing. If the motor is equipped with options like thermocontacts, PTC thermistors or heaters, there are extra terminals for this purpose inside the terminal box.

When open the terminal box, loosen every two fixing bolts diagonally by 3-5 threads gradually then remove all the bolts. When fasten the terminal box, fix the bolts with 3-5 threads left, then fasten every two bolts diagonally till all the fixing bolts are fastened. Or the edge of the terminal cover may crack by stress.

The cable entries – normally metric threads – must at least have the same IP class as the motor. The cable gland will be dimensioned to get a good fit to the cable.

Unused cable gland holes on the terminal box must be sealed to maintain correct IP protection class.

After the motor has been electrically correctly connected with correct cables and cable lugs, tightened the terminal nuts with correct tightening torque according to Table 3, mount the terminal box lid correctly, so the rubber seal will stop water and dust from penetrating the electrical parts inside.

The motor must be installed in accordance with the generally in force principles and regulations by a qualified electrician.

6 Connecting options

6.1 Direct on-line (DOL) start

All BEVI motors are designed to be started – with full nominal load – direct online.

For three phase single speed motors the motor can – depending on voltage supply – be connected Y (star) or D (delta) for correct use of the motor.

For two speed motors, single speed motors or other special motors there are other conditions to consider when connecting the motor. Normally the connection diagram is presented inside the terminal box lid. You can also look in Chapter 10 – Specific motor data – for correct connection diagram.

6.2 Star/Delta (Y/D) start

The Y/D starting method can be used when the supply voltage has the same value as the motor when using D connection.

All connection jumpers on the motor terminal must be removed.

When in need of a low starting current and when

a low starting torque can be accepted (approx. 20-30% of the direct start values) a Y/D-starter can be used as starting method.

At Y/D-start method all connector jumpers on the terminals must be removed to give room for a suitable Y/D-starter. BEVI can provide such switches, <u>www.BEVI.com</u>.

6.3 Output from motor during special ambient situations

The output of motor is based on the operation conditions; ambient -20 $^{\circ}$ C - + 40 $^{\circ}$ C, altitude up to 1000m and S1 duty. If the motor operates at different conditions, the following rating factors shall apply:

6.3.1 Ambient temperature

Maximum ambient temperature is +60 °C, with a derating of output above +40 °C as in table:

| Ambient temperature [°C] | 42,5 | 45 | 47,5 | 50 |
|--------------------------------|------|------|------|------|
| Output factor | 0,98 | 0,96 | 0,94 | 0,93 |
| Ambient temperature [°C] | 52,5 | 55 | 57,5 | 60 |
| Output factor | 0,91 | 0,90 | 0,88 | 0,86 |

Wood drying motors have ambient temperature +90°C and are not included in above table. See Wood drying motors type 3DT, 3DT2, 3DT3, 3DT4 for more information.

6.3.2 Altitude

Maximum altitude above sea level is 4000 m, with a derating of output above +1000 m as in table:

| Hight above sea level [m] | 1500 | 2000 | 2500 |
|------------------------------|------|------|------|
| Output factor | 0,96 | 0,92 | 0,88 |
| Hight above sea level [m] | 3000 | 3500 | 4000 |
| Output factor | 0,84 | 0,80 | 0,76 |

6.3.3 Different supply

Motor winded for 50 Hz can also be supplied with 60 Hz with the following approximated factors:

| Rated | Voltage | Fac | ferent volta | ige | | | | |
|-----------------------------------|-------------|-------|--------------|-------------------|--------------------|-------------------------|--------------------|---------------------|
| supply voltage 50 Hz [V] | 60Hz [V] | Speed | Power | Nominal torque | Starting torque | Break down torque | Nominal current | Starting current |
| 230 | 230 | 1,20 | 1,00 | 0,83 | 0,69 | 0,69 | 1,00 | 0,83 |
| 400 | 380 | 1,19 | 1,00 | 0,79 | 0,63 | 0,63 | 1,05 | 0,79 |
| 400 | 400 | 1,20 | 1,00 | 0,83 | 0,69 | 0,69 | 1,00 | 0,83 |
| 400 | 440 | 1,20 | 1,10 | 0,92 | 0,84 | 0,84 | 1,00 | 0,92 |
| 400 | 460 | 1,20 | 1,15 | 0,96 | 0,92 | 0,92 | 1,00 | 0,96 |
| 400 | 480 | 1,20 | 1,20 | 1,00 | 1,00 | 1,00 | 1,00 | 1,00 |

6.4 Frequency inverter operation

In general, all BEVI three phase single speed motors can work with frequency inverters. The insulation system in modern electric motors is dimensioned to withstand the peaks from the Inverter.

Permissible output parameters of the frequency inverter (measured on the motor terminals – including supply cable between motor and frequency inverter) is $U_{peak} \le 1,35$ kV and $t_r \ge 0.8$ µs.

Normally motor/inverter combination with supply ≤ 480V is below this limit. But with supply >480V actions to protect the motors lifetime need to be

consider. As option you can order special winded motors with reinforced insulation of the copper wires. Or use special filter between motor and inverter to limit dU/dt peaks.

Below table is valid with cable length \leq 150m. For more information about filters (dU/dt, sinewave and/or common mode filters) actions need to take care of based on longer supply cables, we refer to the manufacturer of frequency inverters and/or filter manufacturer.

What type of inverters and motors to choose depends on motor load, speed control range, ventilation/cooling method.

| Nominal supply voltage Un | Motor power < 75kW | Motor power ≥ 75kW and <350kW |
|---------------------------|---|--|
| Un ≤ 480V | Standard insulation | Standard insulation with insulated bearing / bearing end shield on ND side |
| 480V < Un ≤ 600V | Standard insulation + dU/dt filters OR Reinforced insulation | Standard insulation + dU/dt filters + insulated ND bearing / bearing end shield. OR Reinforced insulation + insulated ND bearing / bearing end shield. |
| 600 < Un ≤ 690V | Reinforced insulation AND dU/dt-filters at converter output | Reinforced insulation AND dU/dt-filters at converter output + insulated ND bearing / bearing end shield. |

Table 1 Motor selection when using BEVI frequency inverters.

Instead of dU/dt filter sine-wave filter can be used in most cases, check with the supplier of filter and/or frequency inverter.

6.4.1 Motor cooling

Pay attention when running the motor at lower speed without forced cooling (IC 416). As a general rule, speeds below 50% of the nominal speed on the motor during longer periods leads to a high risk of overheating the motor, since the internal motor fan doesn't rotate fast enough to maintain the necessary cooling degree. Depending on ambient temperature, motors with full load and duty point below 25Hz and higher than 70Hz are normally in need of forced cooling.

6.4.2 Thermal protection

For the reason mentioned in chapter 6.3.1 it is highly recommended to equip the motor with thermal protectors (like PTC thermistors or thermocontacts) and connect it to the frequency Inverter.

6.4.3 Bearing currents

For bigger motors from 75kW and up BEVI normally recommends the use of insulated bearing on the NDE (Non-Drive End) of the motor to prevent bearing currents that can occur when controlling the motor with a BEVI frequency inverter. More detailed data can be viewed in *Table 1*. Other brands of frequency inverters supplying the BEVI motor, BEVI gives no recommendations, *Table 1* can only be used as guideline.

6.4.4 EMC and cables

To fulfil the EMC directive, both EMC cable glands and shielded cables must be used the whole way between the Inverter and the motor, also signal cables must be handled the same way. Be assured that the cable shield will be properly grounded in all ends.

7 Checklist at motor start-up

Before putting the motor into service:

- remove all unnecessary objects from the close surroundings of the motor,
- clean the motor and driven object,
- check whether a free cooling air intake to the fan is ensured,
- check the electrical installation, the circuit breaker, measuring instruments and other auxiliary and protection equipment for correct operation,
- check all the fixing screws and cable connections for safe tightening as well as all elements critical for the motor protection grade,
- check the effectiveness of earthing,
- check whether the set is ready for start-up,
- carry out a test run.

During test run of the set, check:

- line voltage,
- current,
- motor rotating in the correct direction,
- effectiveness of motor cooling and correct coupling with driven object,
- whether abnormal vibrations or other malfunctions of the motor are present,
- temperature rises of respective motor elements, such as bearing shields, bearings, frame.
- starting-up equipment elements, control, and protection devices, for correct operation.
- electrical parameters attained by the motor and evaluated the correctness of motor type selection.

After reaching operating temperature, it is recommended to tighten all electrical connections once more. If the motor operates under conditions where vibrations are unavoidable, the electrical connection should be checked regularly, and be connected with a cable with multi stranded core. After the above recommended procedures are accomplished and correct operation of the drive motor and driven machine is attained, the motor may be regarded as commissioned after installation.

8 Maintenance

8.1 Service of motor during operation

During motor operation carry out the following routine checks:

- motor for correct operation.
- motor cooling effectiveness.
- bearings for correct operation no knocks or whistle are permitted, after approximately 10 hours of running after start-up.
- whether any abnormal vibrations are present.
- motor and driven object coupling condition.
- whether the current consumption [A] is within the rated value (nominal current).

The motor must be immediately stopped, when:

- abnormal temperature rise of the motor frame is started.
- fume or smell of burning get out of the motor or installation.
- motor fan is damaged.
- driven object is damaged.
- for any other reason, when starting-up of motor and driven object is hazardous to the environment.

Restart of the motor is permitted only after all stated faults are rectified.

8.2 Periodical inspections

To maintain the full technical efficiency of the motor, all malfunctions stated during motor operation must be solved and corrected immediately.

Apart from the above rule, each motor in operation should be subjected to the following periodical inspection procedures:

- Minor inspection every 6 month (if the motor operates in a dusty room, every 3 month or even more frequently).
- 2. Major inspection.

The minor inspection of motor could cover the following procedures:

- external visual inspection and motor cleaning.
- measurement of stator winding insulation resistance performed with a 500 V megger.
- checking of all contacts and fixing screws for safe tightening.
- inspection of supply mains cable and earthing conductors.

When signs of wear are noticed during the minor inspection, the major inspection must be performed. Depending on type of wear found the major inspection could cover the following procedures:

- dismantling of motor.
- removal of rotor.
- inspection of stator with particularly attention to the condition of windings.
- winding insulation resistance measurement.
- inspection of rotor.
- inspection of bearings, exchange of grease in the bearing chambers if necessary. (motors with open bearings).
- inspection of start-up-, protection- and control equipment.

All faults stated during the inspection must be removed and used-up parts must be replaced with new ones. It is recommended to renew the protective coatings. During major inspection and eventual repair, be sure the technical requirements quoted in the motor rating plate are met.

It is recommended to subject the motor to curtailed tests. Please contact BEVI for further information. BEVI can also assist with the curtailed tests.

8.3 Bearings and lubrication – general

BEVI motors are normally fitted with ball bearings series 62 & 63. Bigger 4-, 6-, 8-pole motors in foot respectively foot/flange execution can be ordered with series NU roller bearings on DE side. For further information, see Chapter 10 Specific motor data.

The values of admitted radial and axial forces of the shaft, which can be obtained from BEVI, have been calculated at the assumption of some 20000-30000 work hours for the bearings, depending on type.

In case of heavy work conditions and at high radial forces acting on the shaft end the ball bearing at the drive (DE) side can be replaced with a roller bearing series NU2 or NU3 of the same dimensions, if the motor is a 4-, 6- or 8poled horizontally mounted motor.

For vertically mounted motors with high axial loads, angular contact ball bearings type 7xxx is recommended on drive (DE) side.

The wave washer on a standard BEVI motor is normally placed at the NDE side.

Motors with regreaseable bearings are filled with grease - including the bearing chambers - and are ready for operation. However, it is a good idea to give the bearings some more grease during the first run of the motor.

Refilling of bearings with grease should be accomplished during motor operation by means of a grease gun through the grease nipples arranged at the bearing shields. Before refilling the bearings with grease, clean the grease nipples thoroughly.

Regreasing instruction during operation:

 Remove the grease outlet plugs or screws on both Drive End (DE) and Non-Drive End (NDE) side. If necessary – stop the motor and remove the fan cover to reach the grease nipple and grease outlet.

- Clean the grease nipples.
- Inject correct amount of grease into the nipple.
- Let the motor run for 1 hour.
- Clean off the excess grease from the grease outlets and close them with the plugs or screws.

Be aware of rotating parts during regreasing operation!

9 Options

9.1 Thermocontacts

Thermocontacts can as an option be mounted into the motor's windings. Normally one thermocontact for each winding. The three thermocontacts are internally connected in serial, so only two wires will be present in the terminal box.

The function for a thermocontact is normally closed (NC), when the temperature of the winding reaches the rated temperature of the thermocontact bimetal, the contact opens and the contactor connected to the motor and thermocontact will cut off the power to the motor.

A normal temperature for the thermocontact is 140° C or 150° C ± 5K.

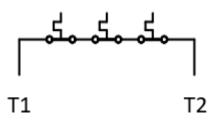


Figure 4 Thermocontact connection. Normally the wires are marked T1-T2 or P1-P2

9.2 Thermistors (PTC)

Just like the thermocontact the PTC thermistor can be ordered as an option. The PTC thermistor is normally mounted one per winding, internally connected in serial, leading to only two wires appearing in the terminal box.

The PTC thermistor needs to be connected to a thermistor relay, BEVI can supply such material,

or when using a frequency inverter, a multifunction contact can be used for controlling the signal from the PTC thermistor.

A normal temperature for the PTC thermistor is 140° C or 150° C.

 


Figure 5 PTC thermistor connection. Normally the wires are marked T1-T2 or P1-P2.

Information about ptc characteristic;

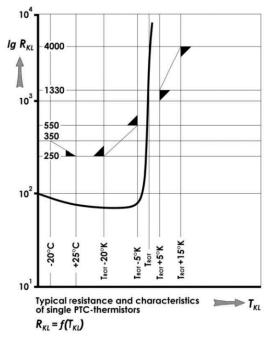



Figure 6 Single Ptc-characteristic

9.3 PT100 sensors

Just like the thermocontact the PT100 can be ordered as an option. The PT100 is normally mounted one per winding. For bigger motors PT100 sensors are mounted near each bearing. Each PT100 sensor cable sets are monitored separately. Normal calibration level for BEVI motors for windings are +140°C and +85°C for bearings.

This kind of Platinum resistive sensors (Pt) is also available as Pt-500 and Pt-1000.

Information about Pt-100 characteristic;

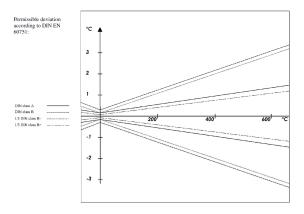



9.4 Forced ventilation (IC416)

Under normal circumstances, the shaft mounted motor fan supplies the electric motor with sufficient airflow to cool the motor down. But when the motor is supplied by a frequency inverter, the motor speed may be too slow to provide sufficient cooling. The solution is to put a forced ventilation at the back of the motor, replacing the shaft-mounted fan.

The motor and forced ventilation shall be connected according to the wiring diagram inside the terminal box. The forced ventilation shall be connected to a fixed frequency power source to work correctly.

There can be a separate terminal box for the forced ventilation, or a separate terminal inside the motor terminal box.

 


Figure 8. Example of single phase forced cooling connection.

 


Figure 9. Example of three phase forced cooling connection.

9.5 Anti-condensation heaters

Anti-condensation heaters are used in cases of a risk of condensation inside the motor. This can occur during long-time standstill of a cold motor in humid air, or intermittent duty where the working motor is having long periods of standstill. In this case the temperature variation inside the motor makes the air to condensate.

The anti-condensation heater is used to heat the inside of the motor, to prevent humidity during standstill.

The anti-condensation heaters shall be connected according to the wiring diagram inside the terminal box, separate power supply.

Do not power the heater while the motor is in operation, only when the motor is at standstill.

9.6 Motor winding anti-condensation

The motor winding can be used as motor heater if a low AC voltage between two winding terminals is available. The value of heating voltage supply depends on motor size and nominal voltage, see Table 2.

| Frame | Motor winding heating voltage at different rated motor voltages. | | | | | | | | | |
|-------|--|-------------|-------------|-------------|-------------|--|--|--|--|--|
| size | 230V [V] | 400V [V] | 440V [V] | 525V [V] | 690V [V] | | | | | |
| 100 | 15 | 30 | 35 | 45 | 60 | | | | | |
| 112 | 15 | 30 | 35 | 45 | 60 | | | | | |
| 132 | 15 | 30 | 35 | 45 | 60 | | | | | |
| 160 | 15 | 25 | 30 | 35 | 45 | | | | | |
| 180 | 15 | 20 | 25 | 30 | 40 | | | | | |
| 200 | 13 | 20 | 25 | 30 | 40 | | | | | |
| 225 | 13 | 20 | 25 | 30 | 40 | | | | | |
| 250 | 10 | 15 | 20 | 25 | 35 | | | | | |
| 280 | - | 15 | 20 | 25 | 30 | | | | | |
| 315 | - | 15 | 20 | 25 | 30 | | | | | |
| 355 | - | 14 | 18 | 22 | 27 | | | | | |
| 400 | - | 14 | 18 | 22 | 27 | | | | | |

Table 2. Motor winding heating voltage at different rated motor voltages.

9.7 Mechanical brake

The mechanical brake is in braking mode at power-off (the motor shaft is locked), when turning the voltage on, the brake releases and the motor shaft is rotating freely.

The motor and DC brake shall be connected according to the wiring diagram inside the terminal box. The DC brake coil shall be connected to a fixed frequency power source to work correctly, for example when the motor is running with a frequency inverter.

The brake torque is correct adjusted at delivery, after a while the air gap for the brake disc may need to be adjusted to work properly.


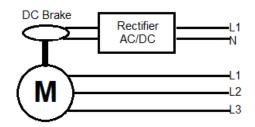



Figure 10. Example of DC brake motor connection


To work safely, the DC brake must have correct voltage supply at all times.

10 Specific motor data

 10.1 Exploded views

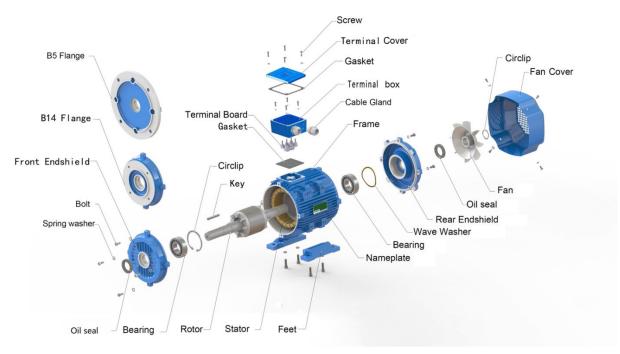



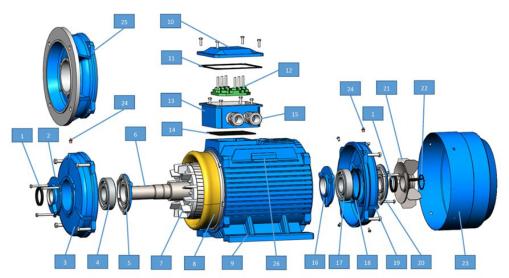

| Name of Parts | Name of Parts | Name of Parts | | |
|-----------------------------|--|-------------------------------|--|--|
| 1 - Shaft seal | 10 - Terminal lid | 19 - Endshield at NDE | | |
| 2 - Outer bearing cap at DE | 11 - Gasket btw terminal lid and box | 20 - Outer bearing cap at NDE | | |
| 3 - Endshield at DE | 12 - Terminal board | 21 - Fan | | |
| 4 - Bearing | 13 - Terminal bracket | 22 - Circlip | | |
| 5 - Inner bearing cap at DE | 14 - Gasket btw terminal bracket and frame | 23 - Fan cowl | | |
| 6 - Shaft | 15 - Cable gland | 24 - Grease nipple | | |
| 7 - Rotor | 16 - Inner bearing cap at NDE | 25 - Flange endshield | | |
| 8 - Stator | 17 - Bearing | 26 - Nameplate base | | |
| 9 - Enclosure | 18 - Spring washer | | | |

Picture 2. Typical exploded view of motors with regreaseable bearings.

10.2 Tightening torque

| | M4 | M5 | M6 | M8 | M10 | M12 | M16 | M18 | M20 | M22 | M24 |
|-----------------------------------|----|-----|----|----|-----|-----|-----|-----|-----|-----|-----|
| Electrical connection [Nm] | 2 | 2,5 | 4 | 8 | 12 | 20 | 40 | - | - | - | - |
| Max torque for foot mounting [Nm] | - | 5 | 8 | 22 | 45 | 75 | 91 | 119 | 150 | 184 | 282 |

Table 3. Tightening torque for electrical connections and foot mounting.

| Cable gland | | | | | | | | |
|-----------------------------|-----|-----|-----|-----|-----|-----|-----|--|
| | M16 | M20 | M25 | M32 | M40 | M50 | M63 | |
| Tightening Torque ±10% [Nm] | 3 | 4 | 7 | 11 | 11 | 11 | 13 | |

Table 4 Tightening torque for cable glands

10.3 Type Sh, 2SIE, 3SIE, 4SIE, SEMh, 3SSIE

10.3.1 Construction

| Size | 56 - 80 | 90 - 112 | 132 | 160 - 315 |
|-------------------|-----------|-----------|-----------|-----------|
| Stator frame | Aluminium | Aluminium | Aluminium | Cast iron |
| Flanges (B5, B14) | Aluminium | Cast iron | Cast iron | Cast iron |
| End shields | Aluminium | Aluminium | Cast iron | Cast iron |

Table 5. Sh, 2SIE, 3SIE, SEMh construction materials.

10.3.2 Bearings

| Frame size | Bearing type | Comments |
|------------|--------------|--|
| 56 | 6201 2Z | |
| 63 | 6202 2Z | |
| 71 | 6203 2Z | |
| 80 | 6204 2Z | |
| 90 | 6205 2Z C3 | Sealed bearings. Two bearings per motor. |
| 100 | 6206 2Z C3 | No lubrication necessary. Replace when needed. |
| 112 | 6306 2Z C3 | |
| 132 | 6308 2Z C3 | |
| 160 | 6309 2Z C3 | |
| 180 | 6311 2Z C3 | |

Table 6. Bearing types for sizes 56-180.

Note – Your motor can be equipped with special designed bearings than standard bearings. Therefore, always check the motor nameplate for correct information regarding your specific motor. BEVI Electric motors, Installation and service instructions

| Frame size | Bearing D-end 2-poles | Regrease bearing [gram] | Replace bearing grease [gram] | Bearing ND-end 2-poles | Regrease bearing [gram] | Replace bearing grease [gram] |
|--------------|-----------------------------|-------------------------------|--|------------------------------|-------------------------------|--|
| 200 | 6312 C3 | 20 | 100 | 6312 C3 | 20 | 100 |
| 225 | 6313 C3 | 23 | 120 | 6313 C3 | 23 | 120 |
| 250 | 6315 C3 | 30 | 170 | 6315 C3 | 30 | 170 |
| 280 | 6315 C3 | 30 | 170 | 6315 C3 | 30 | 170 |
| 315S, MA, MB | 6315 C3 | 30 | 170 | 6315 C3 | 30 | 170 |
| 315MC | 6316 C3 | 35 | 200 | 6316 C3 | 35 | 200 |

Table 7. Bearing types and grease amount for sizes 200-315, 2-pole motors.

| Frame size | Bearing D-end 4-6-8-poles | Regrease bearing [gram] | Replace bearing grease [gram] | Bearing ND-end 4-6-8- poles | Regrease bearing [gram] | Replace bearing grease [gram] |
|--------------|---------------------------------|-------------------------------|--|--------------------------------------|-------------------------------|--|
| 200 | 6312 C3 | 20 | 100 | 6312 C3 | 20 | 100 |
| 225 | 6313 C3 | 23 | 120 | 6313 C3 | 23 | 120 |
| 250 | 6315 C3 | 30 | 170 | 6315 C3 | 30 | 170 |
| 280 | 6318 C3 | 40 | 260 | 6318 C3 | 40 | 260 |
| 315S, MA, MB | 6318 C3 | 40 | 260 | 6318 C3 | 40 | 260 |
| 315 MC, MD | 6320 C3 | 50 | 300 | 6318 C3 | 40 | 260 |

Table 8. Bearing types and grease amount for sizes 200-315, 4-6-8-pole motors.

10.3.3 Lubrication interval

Motor sizes 56-180 are equipped with permanently greased bearings and are in no need of regreasing. Motors sizes 200-315 are to be serviced according to *Table 9* below.

| Frame size | Regrease or replace | Speed 3600 rpm | Speed 3000 rpm | Speed 1800 rpm | Speed 1500 rpm | Speed 1000- 1200 rpm | Speed <1000 rpm |
|---------------|---------------------|----------------------|----------------------|----------------------|----------------------|-------------------------------|-----------------------|
| 200 | Regrease | 1100 h | 1300 h | 1700 h | 2000 h | 3300 h | 3500 h |
| 200 | Replace | 5500 h | 8000 h | 14500 h | 17500 h | 23000 h | 25000 h |
| 225 | Regrease | 1050 h | 1250 h | 1600 h | 1900 h | 3000 h | 3300 h |
| 225 | Replace | 5000 h | 6500 h | 13000 h | 16500 h | 22000 h | 24000 h |
| 250 | Regrease | 900 h | 1100 h | 1400 h | 1600 h | 2700 h | 3000 h |
| 250 | Replace | 4500 h | 5000 h | 9000 h | 11500 h | 15000 h | 18000 h |
| 280 | Regrease | 750 h | 900 h | 1200 h | 1500 h | 2500 h | 2700 h |
| 280 | Replace | 3750 h | 4500 h | 6000 h | 8000 h | 12500 h | 15000 h |
| 315 | Regrease | 750 h | 900 h | 1200 h | 1500 h | 2500 h | 2500 h |
| 315 | Replace | 3000 h | 4000 h | 5900 h | 7600 h | 11800 h | 13000 h |

Table 9. Time schedule for regrease/replacement of lubrication.

REMARKS


- 1. In case of motors operating in temperature above 40°C it's necessary to shorten mentioned above time of operation between regreasing and grease exchange.
- 2. Periods of regreasing in case of motors operating in <u>vertical position</u> should be <u>shortened by 50%</u> <u>of the above intervals</u>.
- 3. Your motor can be special designed and have other bearings than standard bearings. Therefore, always check the motor nameplate for correct information regarding your actual motor.
- 4. Periods of regreasing in case of motors with <u>roller bearings</u> (NU) should be <u>shortened by 50% of</u> <u>the above intervals</u>.
- 5. Lubrication quality/recommended grease:

| Motor type 2Sg | Motor type 2SIE/3SIE/4SIE |
|---|---|
| Size 200-280 | Size 200-250 |
| Renolit H443-HD 88 alt. SKF LGWA2 or equal | Renolit H443-HD 88 alt SKF LGWA2 or equal |
| Size 315 | Size 280-315 |
| Renolit Duraplex EP2 alt. SKF LGWA2 or equal | Renolit Duraplex EP2 alt. SKF LGWA2 or equal |

Note – Your motor can be equipped with special designed bearings than standard bearings. Therefore, always check the motor nameplate for correct information regarding your specific motor.

10.3.4 Connection diagrams Sh, 2SIE, 3SIE, 4SIE, SEMh, 3SSIE

 Three phase single speed motors



Connection in Δ (Delta)

Connection in Y (Star)

Figure 11. Standard three phase single speed motor

Three phase dual speed motors

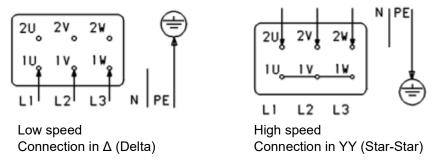


Figure 4. Three phase dual speed motor with single winding (Dahlander), like 4/2-, 8/4-, 12/6-pole.

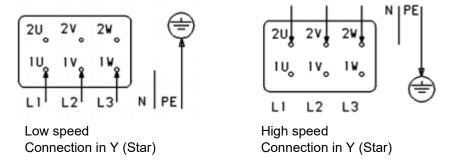


Figure 5. Three phase dual speed motor with separate windings, like 6/4-, 8/6-pole.

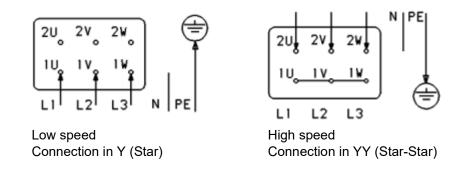


Figure 14. Three phase dual speed motor for ventilation application, with single windings (Dahlander), like 4/2-, 8/4-pole. Motor marked with "W" on the motor data plate.

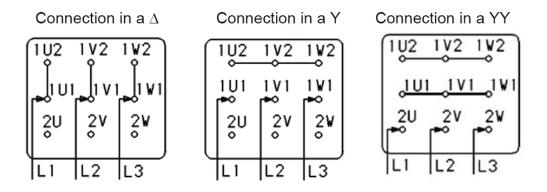


Figure 15. Three phase dual speed motor (nine terminals, for example 4/2-, 8/4-pole.

Single-phase single speed motors

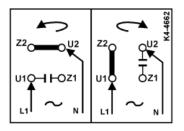


Figure 16. Single phase motor type SEMh/3SSIE, with run capacitor.

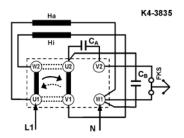


Figure 17. Single phase motor type SEMh-F with Start capacitor C_A , run capacitor C_B and centrifugal switch.

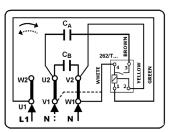


Figure 18. Single phase motor type 3SSIE with Start capacitor CA, run capacitor CB and centrifugal switch.

| 824/CR CB W20 U20 V20 V20 V10 W10 L1 N | 824/CR V2 V1 V1 V1 V1 V1 V1 V1 V1 V1 V1 |
|---|--|

Figure 19. Single phase motor type 3SSIE with Start capacitor CA, run capacitor CB and integrated electrical switch.

10.4 Type 4A, 4A2, 4A3, 4A4, 4D, 4D2, 4D3, 4D4

10.4.1 Construction

| Туре | 4A, 4A2, | 4A, 4A2, 4A3, 4A4 | | |
|--------------|----------------|-------------------|-----------|--|
| Size | 56-132 160-180 | | 80-355 | |
| Stator frame | Aluminium | Aluminium | Cast iron | |
| End shields | Aluminium | Aluminium | Cast iron | |
| Flange | Aluminium | Cast iron | Cast iron | |

Table 10. 4A, 4A2, 4A3,4D, 4D2 and 4D3 motors construction materials

10.4.2 Bearings 4A, 4A2, 4A3, 4A4, 4D, 4D2, 4D3, 4D4

| Frame size | Bearing type | Comments |
|------------|--------------|---|
| 56 | 6201 2RS C3 | |
| 63 | 6202 2RS C3 | |
| 71 | 6202 2RS C3 | |
| 80 | 6204 2RS C3 | |
| 90 | 6205 2RS C3 | Sealed bearings. Two bearings per motor. No lubrication necessary. Exchange when needed. |
| 100 | 6206 2RS C3 | |
| 112 | 6306 2RS C3 | |
| 132 | 6308 2RS C3 | |
| 160 | 6309 2RS C3 | |

Table 11. Bearing types for sizes 56-160 for 4A, 4A2, 4A3, 4A4, 4D, 4D2, 4D3, 4D4 motors.

| Frame size | Bearing D-end 2-poles | Bearing ND-end 2-poles | Bearing D-end 4-6-8-poles | Bearing ND-end 4-6-8-poles |
|------------|-----------------------------|------------------------------|---------------------------------|----------------------------------|
| 180 | 6311 C3 | 6311 C3 | 6311 C3 | 6311 C3 |
| 200 | 6312 C3 | 6312 C3 | 6312 C3 | 6312 C3 |
| 225 | 6313 C3 | 6313 C3 | 6313 C3 | 6313 C3 |
| 250 | 6314 C3 | 6314 C3 | 6314 C3 | 6314 C3 |
| 280 | 6314 C3 | 6314 C3 | 6317 C3 | 6317 C3 |
| 315 | 6317 C3 | 6317 C3 | NU 319 C3 | 6319 C3 |
| 355 | 6319 C3 | 6319 C3 | NU 322 C3 | 6322 C3 |

Table 12. Bearing types for sizes 180-355 for 4D, 4D2, 4D3, 4D4 motors.

Note – Your motor can be equipped with special designed bearings than standard bearings. Therefore, always check the motor nameplate for correct information regarding your specific motor.

| Frame size | Regrease bearing [gram] | 3600 rpm | 3000 rpm | 1800 rpm | 1500 rpm | 1200 rpm | 1000 rpm | 500-900 rpm |
|---------------|-------------------------------|-------------|-------------|-------------|-------------|-------------|-------------|----------------|
| 112 | 15 | 4200 | 4800 | 7000 | 7800 | 8500 | 10000 | 10500 |
| 132 | 15 | 4200 | 4800 | 7000 | 7800 | 8500 | 10000 | 10500 |
| 160 | 20 | 3200 | 4200 | 6000 | 7000 | 8000 | 9000 | 10000 |
| 180 | 20 | 3200 | 4200 | 6000 | 7000 | 8000 | 9000 | 10000 |
| 200 | 25 | 1800 | 3100 | 5500 | 6500 | 7500 | 8500 | 9500 |
| 225 | 25 | 1800 | 3100 | 5500 | 6500 | 7500 | 8500 | 9500 |
| 250 | 35 | 800 | 2000 | 5000 | 6000 | 7000 | 8000 | 9000 |
| 280 | 35 | 800 | 2000 | 5000 | 6000 | 7000 | 8000 | 9000 |
| 315 | 50 | 800 | 2000 | 4600 | 5500 | 6500 | 7500 | 8000 |
| 355 | 60 | 400 | 1000 | 4000 | 5000 | 6000 | 7000 | 8000 |
| 400 | 60 | | 1000 | 4000 | 5000 | 6000 | 7000 | 8000 |

10.4.3 Lubrication interval

Table 13. Lubrication intervals in duty hours [h].

REMARKS

- 1. In case of motors operating in temperature above 40°C it's necessary to shorten mentioned above time of operation between regreasing and grease exchange.
- 2. Periods of regreasing in case of motors operating in <u>vertical position</u> should be <u>shortened by</u> <u>50% of the above intervals</u>.
- Your motor can be special designed and have other bearings than standard bearings. Therefore, always check the motor nameplate for correct information regarding your actual motor.
- 4. Periods of regreasing in case of motors with <u>roller bearings</u> (NU) should be <u>shortened by 50%</u> <u>of the above intervals</u>.
- 5. Lubrication quality/recommended grease:

Recommended grease: Mobil UNIREX N2, SKF LGWA2 or equal.

Mixing different greases is not recommended, as not all greases are compatible with each other.

<u>Do not mix different grease types</u>. Some greases may lose their grease capabilities when mixed.

10.4.4 Connection diagrams 4A, 4A2, 4A3, 4A4, 4D, 4D2, 4D3, 4D4

Three phase single speed motors

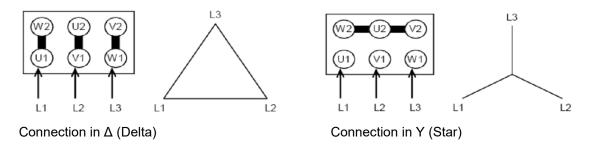
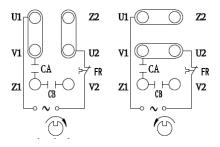


Figure 20. Standard three phase single speed motor.

Single phase single speed motors





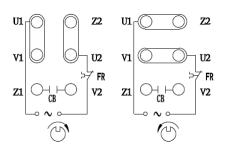


Figure 22 - Single phase motor type GMYC with start capacitor CB and FR protector

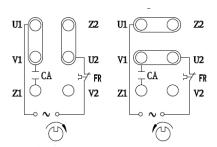


Figure 23 - Single phase motor type GMYY with run capacitor CA and FR protector

10.5Type 3D, 3D2, 3D3, 3D4

10.5.1 Construction

| Size | 80-400 |
|--------------|-----------|
| Stator frame | Cast iron |
| End shields | Cast iron |

Table 14. 3D, 3D2, 3D3 and 3D4 motors construction materials.

10.5.2 Bearings 3D, 3D2, 3D3, 3D4

| Frame size | Bearing type | Comments |
|------------|--------------|--|
| 80 | 6204 2RS C3 | |
| 90 | 6205 2RS C3 | |
| 100 | 6206 2RS C3 | Sealed bearings. Two bearings per motor. No lubrication necessary. Replace when needed. |
| 112 | 6206 2RS C3 | The hadroad of here of the her |
| 132 | 6208 2RS C3 | |

Table 15. Bearing types for sizes 80-132 for 3D, 3D2, 3D3, 3D4 motors.

| Frame size | Bearing D-end 2-poles | Bearing ND-end 2-poles | Bearing D-end 4-6-8-poles | Bearing ND-end 4-6-8-poles |
|------------|--------------------------|---------------------------|------------------------------|-------------------------------|
| 160 | 6309 C3 | 6309 C3 | 6309 C3 | 6309 C3 |
| 180 | 6311 C3 | 6311 C3 | 6311 C3 | 6311 C3 |
| 200 | 6312 C3 | 6312 C3 | 6312 C3 | 6312 C3 |
| 225 | 6312 C3 | 6312 C3 | 6313 C3 | 6313 C3 |
| 250 | 6314 C3 | 6314 C3 | 6314 C3 | 6314 C3 |
| 280 | 6316 C3 | 6316 C3 | 6316 C3 ² | 6316 C3 |
| 315 | 6316 C3 | 6316 C3 | 6319 C3 | 6319 C3 |
| 355 | 6319 C3 | 6319 C3 | 6322 C3 | 6319 C3 |
| 400 | 6319 C3 | 6319 C3 | NU326 ECM C3 | 6326 C3 |

Table 16. Bearing types for sizes 160-400 for 3D, 3D2, 3D3, 3D4 motors.

Note – Your motor can be equipped with special designed bearings than standard bearings. Therefore, always check the motor nameplate for correct information regarding your specific motor.

² When insulated bearings are used on 280-size 4-, 6- and 8-pole motors, DE-side will have 6317 C3 and NDE-side will have 6317 C3 VL0241.

| Frame size | Bearing D-end 2-poles | Bearing ND-end 2-poles | | |
|------------|--------------------------|---------------------------|------------|--------------|
| 160 | 7309BEP | 6309 C3 | 7309BEP | 6309 C3 |
| 180 | 7311BEP | 6311 C3 | 7311BEP | 6311 C3 |
| 200 | 7312BEP | 6312 C3 | 7312BEP | 6312 C3 |
| 225 | 7312BEP | 6312 C3 | 7313BEP | 6313 C3 |
| 250 | 7314BEP | 6314 C3 | 7314BEP | 6314 C3 |
| 280 | 7316BEP | 6316 C3 | 7316BEP | 6316 C3 |
| 315 | 7316BEP | 6316 C3 | 7319BEP | 6319 C3 |
| 355 | 7319BEP | 6319 C3 | 7322BEP | 6319 C3 |
| 400 | 7319BEP | 6319 C3 | 2×7226BCBM | NU226 ECJ C3 |

Table 17. 3D, 3D2, 3D3, 3D4 sizes 160-400 motors with heavy axial load in V1 vertical mounting position can as **option** be ordered with angular contact ball bearings.

Note – Your motor can be equipped with special designed bearings than standard bearings. Therefore, always check the motor nameplate for correct information regarding your specific motor.

| Frame size | Regrease bearing [gram] | 3600 rpm | 3000 rpm | 1800 rpm | 1500 rpm | 1200 rpm | 1000 rpm | 500-900 rpm |
|---------------|-------------------------------|-------------|-------------|-------------|-------------|-------------|-------------|----------------|
| 112 | 15 | 4200 | 4800 | 7000 | 7800 | 8500 | 10000 | 10500 |
| 132 | 15 | 4200 | 4800 | 7000 | 7800 | 8500 | 10000 | 10500 |
| 160 | 20 | 3200 | 4200 | 6000 | 7000 | 8000 | 9000 | 10000 |
| 180 | 20 | 3200 | 4200 | 6000 | 7000 | 8000 | 9000 | 10000 |
| 200 | 25 | 1800 | 3100 | 5500 | 6500 | 7500 | 8500 | 9500 |
| 225 | 25 | 1800 | 3100 | 5500 | 6500 | 7500 | 8500 | 9500 |
| 250 | 35 | 800 | 2000 | 5000 | 6000 | 7000 | 8000 | 9000 |
| 280 | 35 | 800 | 2000 | 5000 | 6000 | 7000 | 8000 | 9000 |
| 315 | 50 | 800 | 2000 | 4600 | 5500 | 6500 | 7500 | 8000 |
| 355 | 60 | 400 | 1000 | 4000 | 5000 | 6000 | 7000 | 8000 |
| 400 | 60 | | 1000 | 4000 | 5000 | 6000 | 7000 | 8000 |

10.5.3 Lubrication interval

Table 18. Lubrication intervals in duty hours [h].

REMARKS

- 1. In case of motors operating in temperature above 40°C it's necessary to shorten mentioned above time of operation between regreasing and grease exchange.
- 2. Periods of regreasing in case of motors operating in <u>vertical position</u> should be <u>shortened by</u> <u>50% of the above intervals</u>.
- Your motor can be special designed and have other bearings than standard bearings. Therefore, always check the motor nameplate for correct information regarding your actual motor.
- 4. Periods of regreasing in case of motors with <u>roller bearings</u> (NU) should be <u>shortened by 50%</u> <u>of the above intervals</u>.
- 5. Lubrication quality/recommended grease:

Recommended grease: Mobil UNIREX N2, SKF LGWA2 or equal.

Mixing different greases is not recommended, as not all greases are compatible with each other.

<u>Do not mix different grease types</u>. Some greases may lose their grease capabilities when mixed.

10.5.4 Connection diagrams 3D, 3D2, 3D3, 3D4

Three phase single speed motors


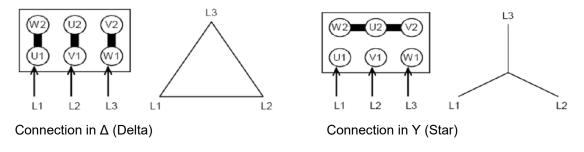


Figure 24. Standard three phase single speed motor.

Three phase dual speed motors

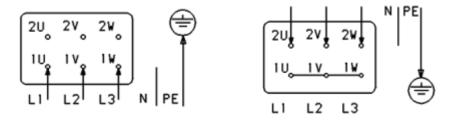

Low speed

High speed

Figure 25. Three phase dual speed motor with single winding (Dahlander), like 4/2-, 8/4-, 12/6-pole.

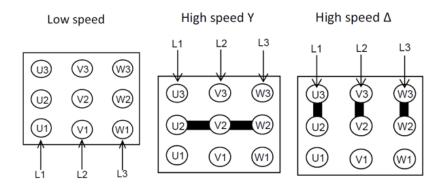


Figure 26. Three phase dual speed motor with separate windings, like 4/6-pole. Y/D-start at high speed.

10.6 Wood drying motors type 3DT, 3DT2, 3DT3, 3DT4

10.6.1 Specific features for motors type 3DT, 3DT2, 3DT3, 3DT4

<u>Cooling</u>

As standard, the wood drying motors are delivered without a shaft mounted cooling fan (standard designation IC418). The motor is cooled by the air flow from the shaft mounted fan (supplied by the customer). Other cooling methods can be supplied, for example a NDE shaft mounted fan and fan cowl (IC411).

Insulation

These motors are delivered with insulation class H as standard.

<u>Others</u>

Fasteners and motor plate are in stainless steel.

10.6.2 Construction

| Size | 90-250 |
|--------------|-----------|
| Stator frame | Cast iron |
| End shields | Cast iron |

Table 19. 3DT, 3DT2, 3DT3, 3DT4 motors construction materials.

10.6.3 Bearings 3DT, 3DT2, 3DT3, 3DT4

| Frame size | Bearing type | Comments |
|------------|--------------|--|
| 90 | 6205 2Z C3 | |
| 100 | 6206 2Z C3 | Sealed bearings. Two bearings per motor. |
| 112 | 6206 2Z C3 | No lubrication necessary. Replace when needed. |
| 132 | 6208 2Z C3 | |

Table 20. Bearing types for sizes 90-132 for 3DT, 3DT2, 3DT3, 3DT4 motors.

| Frame size | Bearing D-end | Bearing ND-end |
|------------|---------------|----------------|
| 160 | 6309 C3 | 6309 C3 |
| 180 | 6311 C3 | 6311 C3 |
| 200 | 6312 C3 | 6312 C3 |
| 225 | 6313 C3 | 6313 C3 |
| 250 | 6314 C3 | 6314 C3 |

Table 21. Bearing types for sizes 160-250 for 3DT, 3DT2, 3DT3, 3DT4 motors.

Note – Your motor can be equipped with special designed bearings than standard bearings. Therefore, always check the motor nameplate for correct information regarding your specific motor.

10.6.4 Connection diagrams 3DT, 3DT2, 3DT3, 3DT4

See connection diagram on previous page for motor types of 3D, 3D2, 3D3, 3D4

10.6.5 Lubrication interval

The BEVI wood drying motors must be regreased:

- At an environmental drying temperature of +90°C every 600 duty hours, or every 60 day.
- At an environmental drying temperature of +75°C every 1000 duty hours, or every 60 day.

| Frame size | Regrease bearing [gram] |
|------------|-------------------------|
| 90 | 4 |
| 100 | 5 |
| 112 | 10 |
| 132 | 16 |
| 160 | 20 |
| 180 | 20 |
| 200 | 25 |
| 225 | 25 |
| 250 | 35 |

Table 22. Lubrication intervals in duty hours [h].

Note that frame size 90 - 132 are normally equipped with sealed bearings and that they are not regreasable.

After 8000 working hours the motor's bearing grease must be fully replaced. Dismantle the motor and clean all the bearing parts thoroughly. After the cleaning is ready, a new coat of grease can be applied.

REMARKS

- 1. Periods of regreasing in case of motors operating in <u>vertical position</u> should be <u>shortened by</u> <u>50% of the above intervals</u>.
- Your motor can be special designed and have other bearings than standard bearings. Therefore, always check the motor nameplate for correct information regarding your actual motor.
- 3. Periods of regreasing in case of motors with <u>roller bearings</u> (NU) should be <u>shortened by 50%</u> <u>of the above intervals</u>.
- 4. Lubrication quality/recommended grease:

Recommended grease: Renolit Uniway LiX 815 Pa HP or equal.

Mixing different greases is not recommended, as not all greases are compatible with each other

<u>Do not mix different grease types</u>. Some greases may lose their grease capabilities when mixed.

10.7 Type 2EL, 3EL, 4EL, 3EC, 2EG, 3EG, 4EG

10.7.1 Construction

| Size | 56 – 112 (EL) | 132 – 180 | 200 – 315 (EG) |
|-------------------|---------------|----------------------------------|----------------|
| Stator frame | Aluminium | Aluminium (EL) Cast iron (EG) | Cast iron |
| Flanges (B5, B14) | Aluminium | Aluminium (EL) Cast iron (EG) | Cast iron |
| End shields | Aluminium | Aluminium (EL) Cast iron (EG) | Cast iron |

Table 23. 2 EL, 3EL, 4EL, 3EC, 2EG, 3EG, 4EG

10.7.2 Bearings

| Frame size | Bearing type | Comments |
|------------|--------------|--|
| 63 | 6201 2Z | |
| 71 | 6202 2Z | |
| 80 | 6204 2Z | |
| 90 | 6205 2Z | |
| 100 | 6206 2Z | |
| 112 | 6206 2Z | Sealed bearings. Two bearings per motor. |
| 132 | 6208 2Z | No lubrication necessary. Replace when needed. |
| 160 | 6309 2Z | |
| 180 | 6310 2Z | |
| 200 | 6312 2Z | |
| 225 | 6313 2Z | |
| 250 | 6315 2Z | |

Table 24. Bearing types for sizes 63-250.

| Frame size | Bearing D-end 2-poles | Regrease bearing [gram] | Replace bearing grease [gram] | Bearing ND-end 2-poles | Regrease bearing [gram] | Replace bearing grease [gram] |
|------------|-----------------------------|-------------------------------|--|------------------------------|-------------------------------|--|
| 280 | 6315 | 30 | 170 | 6315 | 30 | 170 |
| 315 | 6316 | 33 | 170 | 6315 | 33 | 170 |

Table 25. Bearing types and grease amount for sizes 280-315, 2-pole motors.

| Frame size | Bearing D-end 4-6-8-poles | Regrease bearing [gram] | Replace bearing grease [gram] | Bearing ND-end 4-6-8- poles | Regrease bearing [gram] | Replace bearing grease [gram] |
|------------|---------------------------------|-------------------------------|--|--------------------------------------|-------------------------------|--|
| 280 | 6317 | 38 | 260 | 6317 | 38 | 260 |
| 315 | 6319 | 45 | 260 | 6319 | 45 | 260 |

Table 26. Bearing types and grease amount for sizes 280-315, 4-6-8-pole motors.

Note – Your motor can be equipped with special designed bearings than standard bearings. Therefore, always check the motor nameplate for correct information regarding your specific motor.

10.7.3 Lubrication interval

Motor sizes 56-250 are equipped with permanently greased bearings and are in no need of regreasing. Motors sizes 280-315 are to be serviced according to lubrication table

| Frame size | Pole | DE | NDE |
|------------|--------|--------|---------|
| 280 | 2-pole | 3200 h | 3200 h |
| 280 | 4-pole | 3750 h | 4500 h |
| 280 | 6-pole | 9000 h | 11000 h |
| 315 | 2-pole | 2900 h | 2900 h |
| 315 | 4-pole | 6400 h | 6900 h |
| 315 | 6-pole | 9700 h | 10400 h |

Table 27. Time schedule for regrease/replacement of lubrication.

 
Recommended grease: Mobil Polyrex EM or equal.

Mixing different greases is not recommended, as not all greases are compatible with each other.


REMARKS

- 1. In case of motors operating in temperature above 40°C it's necessary to shorten mentioned above time of operation between regreasing and grease exchange.
- Periods of regreasing in case of motors operating in <u>vertical position</u> should be <u>shortened by 50%</u> of the above intervals.
- 3. Periods of regreasing in case of motors with <u>roller bearings</u> (NU) should be <u>shortened by 50% of</u> <u>the above intervals</u>.
- 10.7.4 Connection diagrams 2EL, 3EL, 4EL, 3EC, 2EG, 3EG, 4EG

Three phase single speed motors




Y Star Connection

 

▲ Delta Connection

0

 Single phase single speed motors



Circuit Connection

Clockwise Direction

34

Counter-Clockwise Direction

U2

11 Troubleshooting

| Electrical failure | Cause | Solution |
|---|--|---|
| 1 - Motor fails to start | 1) Power supply is not switched on. | 1) Check switch, fuses, contactors and motor cable lugs. |
| | 2) Stator winding is broken. | 2) Leave the motor to a skilled and certified service partner who will heat the broken part to the permissible insulation temperature to soften the varnish, pick up the disconnected wires and weld them. Then wrap the coils, varnish them and make them dry. |
| | 3) Either winding earthed or short circuit between phases. | 3) Leave the motor to skilled and certified service partner who will use the same method as 2) and make the earthed or short circuit portion insulated then varnish and dry the part. |
| | 4) Connection mistakes in stator winding. | 4) Leave the motor to skilled and certified service partner who will check connection diagram, heat the end turns and reconnect them correctly, then wrap, insulate and varnish them. |
| | 5) Fuse burnt out. | 5) Troubleshot and find out the cause. Replace the fuse with a new one. |
| | 6) Wrong connection in the control device. | 6) Check and correct the wiring connection. |
| 2 - Fuse burnt after motor energized | 1) Single-phase start. | 1) Check power source cables, motor cables, fuses and switch contactors to find the broken wires or connection failures then solve the problems. |
| | 2) Motor is overloaded or locked. | 2) Adjust load value to rated one and deal with driven machine failure. |

| Electrical failure | Cause | Solution |
|--|--|---|
| 3 - After energized, motor cannot start but has noise | 1) Motor is overloaded or locked. | 1) Inspect equipment and shoot the trouble. |
| | 2) Check power sources so all phases have correct voltage. | 2) Check connection of supply and/or feed.Replace fuse, fasten the loosened bolts the terminals, check the power source cables etc. with an instrument suitable for this work. |
| | 3) too low voltage. | 3) Change to Delta connection if it was misconnected as Star; Contact the power supply station if it is caused by power source; Adopt bigger cables if it is caused by the voltage drop of cables. |
| | 4) Stearin grease or tight fitness for small-sized motors. | 4) Select applicable grease and increase assembly quality. |
| 4 - Live motor enclosure | 1) Mix the power source cables and earthing cables. | 1) Correct the mistake. |
| | 2) Stator winding becomes damp and insulation ages severely. | 2) Dry the motor and renew the aged insulation. |
| | 3) Lead cables and terminal box are earthed. | 3) Bind or renew outlet insulation and repair terminal box. |
| 5 - Hard to start and speed lower than rated speed at full load | 1) Power source voltage is too low. | 1) Measure the power voltage at input points with a voltmeter or avometer and find the solution. |
| | 2) Delta connection is misconnected as Star. | 2) Change Star connection back to Delta. |
| | 3) The rotor is coming off or broken. | 3) Check and repair the rotor. |
| | 4) Coils are more than original when rewound the winding. | 4) Rewind the coils according to correct numbers. |
| | 5) Winding gets moist or motor suffers from rain. | 5) Heat to dry the motor. |
| | 6) Aged winding insulation. | 6) Coat the winding insulation or replace the insulation. |
| 6 - Low insulation resistance | 1) Winding gets moist or motor suffers from rain. | 1) Heat to dry the motor. |
| | 2) Aged winding insulation. | 2) Coat the winding insulation or replace the insulation. |

| Electrical failure | Cause | Solution |
|--|---|--|
| 7 - Abnormal noise during operation | 1) Bearings are worn. | 1) Repair or replace bearings. |
| | 2) Stator or rotor core is loose. | 2) Find the cause of vibration, re-press the core. |
| | 3) Voltage is too high or unbalanced. | 3) Measure the voltage on power source, find the cause and solve it. |
| | 4) Bearing short of grease. | 4) Clean the bearing and replenish grease with the amount of one-third to half of the bearing chamber volume. |
| | 5) Fan contacts fan cover or the ventilation is blocked. | 5) Repair fan and fan cowl and clear up ventilation area. |
| 8 - Motor overheat or smoking | 1) Too high power source voltage makes flux density in stator core oversaturated and results in high temperature rise. | 1) If supply voltage excesses standard value too much, contact power supply department. |
| | 2) Too low power source voltage makes high temperature rise at full load. | 2) Replace the cables by bigger ones if it is caused by voltage drop. Contact the power supply department if it is caused by low voltage. |
| | 3) Stator and rotor interfered. | 3) If it is caused by larger bearing clearance, replace the bearing. If it is caused by the shaft which is bent, align it. Repair the core if it is loose or deformed. |
| | 4) Motor overload or big resistance from the driven machine, which lead to high temperature. | 4) Solve the trouble of driven machine, reduce load if exceeding rated current as per the indication, adopt a larger motor or increase the capacity. |
| | 5) Frequently starting or too many reverse rotations. | 5) Reduce number of starts and reverse rotations or adopt an applicable motor. |
| | 6) Fan failure or poor ventilation. | 6) Check the fan to see whether it is damaged or the blades are deformed or not fixed properly. Replace the fan if necessary. |
| 9 - Unbalanced no load current at big difference | 1) Unbalanced power source voltage. | 1) Measure the source voltage to find the cause. |
| | 2) Winding failures such as short circuit coils, wrongly connected coils and etc. | 2) Disassemble the motor to check polarity and failures in windings, correct polarity or shoot the troubles. |
| | 3) Coils and turns are not equally distributed after rewind the stator winding. | 3) Rewind the stator winding as per the instructions. |

| Mechanical failure | Cause | Solution |
|---------------------------------|--|--|
| 1 - Vibration | 1) Worn bearing or the poor bearing clearance. | 1) Check bearing clearance. |
| | 2) Air gaps are not even. | 2) Adjust air gap to meet specifications. |
| | 3) Unbalanced fan or rotor. | 3) Find out the cause and balance the fan, the rotor or the motor. |
| | 4) The rigidity of enclosure or the foundation is not strong enough. | 4) Find the root to reinforce the enclosure rigidity or foundation. Align the motor and fasten it. |
| | 5) Shaft is bent. | 5) Align the shaft. |
| | 6) Rotor core is deformed or loose. | 6) Adjust the iron core and then stack it again. |
| | 7) Loose mounting/fixing bolts. | 7) Fasten the bolts or replace them by qualified ones. |
| 2 - High bearing temperature | 1) Either too much or too less grease. | 1) Replenish the bearing with grease according to operation instructions. |
| | 2) Poor grease with impurities. | 2) Check the impurities of grease and change to clean grease. |
| | 3) Oil seal is fit too tight. | 3) Repair or replace the oil seal. |
| | 4) Eccentric inner bearing cap contacts the shaft. | 4) Repair inner bearing cap to keep proper gap with shaft. |
| | 5) End shields or bearing caps are not assembled properly. | 5) Put end shield or bearing cap into spigot by correct process and then fasten bolts evenly. |
| | 6) Bearings are worn or dirt etc. | 6) Replace the damaged bearing. Clean the dirt bearings thoroughly and replenish grease. |
| | 7) Eccentric coupling connection or too tight belt. | 7) Align the motor with driven machine and adjust the tension of belt. |
| | 8) Improper bearing size. | 8) Select proper bearing size. |
| | 9) Too big or too less bearing clearance. | 9) Replace the bearing. |

BEVI Electric motors, Installation and service instructions



Sweden

BEVI AB (Head office) Blomstermåla Tlf. +46 499 271 00 info@bevi.se www.bevi.se

Finland

BEVI Finland OY AB Espoo TIf. +358 9 2709 1210 info@bevi.fi www.bevi.fi

India

BEVI Electric Private Limited. Chennai Tlf. +91 9444168976 alexander.daniel@bevi.com www.bevi.com

BEVI AB Umeå Tlf. +46 90 70 44 30

bevinord@bevi.se www.bevi.se

Norway

BEVI Norge AS Oslo Tlf. +47 23 19 16 50 info@bevi.no www.bevi.no

Denmark

BEVI A/S Albertslund Tlf. +45 39 67 36 05 bevi@bevi.dk

www.bevi.dk

China

BEVI Electric Shanghai Co., Ltd. Shanghai Tlf. +86 21 5032 5200 sales@bevi.cn www.bevi.cn

